

Carrière de la Belle Roche

Attn M Patrick Van Haeren

Rue d'Aywaille, 191

4170 COMBLAIN-AU-PONT

V. Réf. :

N. Réf. : BCG/ba/10713-217

Namur, le 23/01/2024

Monsieur,

Concerne : Tir du mardi 23 janvier 2024 - 15h01
Rapport de vibrations

Veillez trouver ci-jointes les mesures de vibrations relatives au tir de ce mardi 23 janvier 2024 à 15h01 à la carrière de la Belle Roche.

Localisation des capteurs

- 10713-01 : Garage Honda, Route d'Aywaille, 61 à 4170 Comblain-au-Pont
- 10713-03 : M Martin Bernard, Rue du Crokin ,4 à Fraiture

Seuil de déclenchement : 0.250 mm/s

Résultats

Capteur 10713-01 : Aucun dépassement observé de la norme à respecter (courbe intermédiaire).

Capteur 10713-03 : Vibration trop faible. Aucun déclenchement.

Benoit ANDRE
Directeur - Gérant
Géologue - Hydrogéologue

B C G - Report


Telephone: +32 81 58 26 11

1/23/2024 at 15:01:51 Event # 3949

Graph: 11600
 Last Calibration: 25Jun14
 Record Duration: 6 sec
 Sample Rate: 2048/sec

Company: BRS
Location: Garage Honda
Operator: BA
 Notes:

Amplitudes / Frequencies	Trigger >>> Peak	Scales / Triggers	Charge / Distance
○ Radial: 0.302 mm/s @ 48.7 Hz	51.3 ms	Air Scale: .00799 kPa/div.	Wgt. Per Delay: N
○ Transverse: 0.270 mm/s @ 64 Hz	0 ms	Seismic Scale: 8.13 mm/s/div.	Distance: N
○ Vertical: 0.238 mm/s @ 20.4 Hz	83.0 ms	Air Trigger: N	Scaled Distance: 0.0
○ Air: 101.9 dBL @ 9.3Hz / .0025kPa	3371.6 ms	Seismic Trigger: .254 mm/s	
▽ Vector Sum: 0.32 mm/s @ 44.5 Hz	51.3 ms		

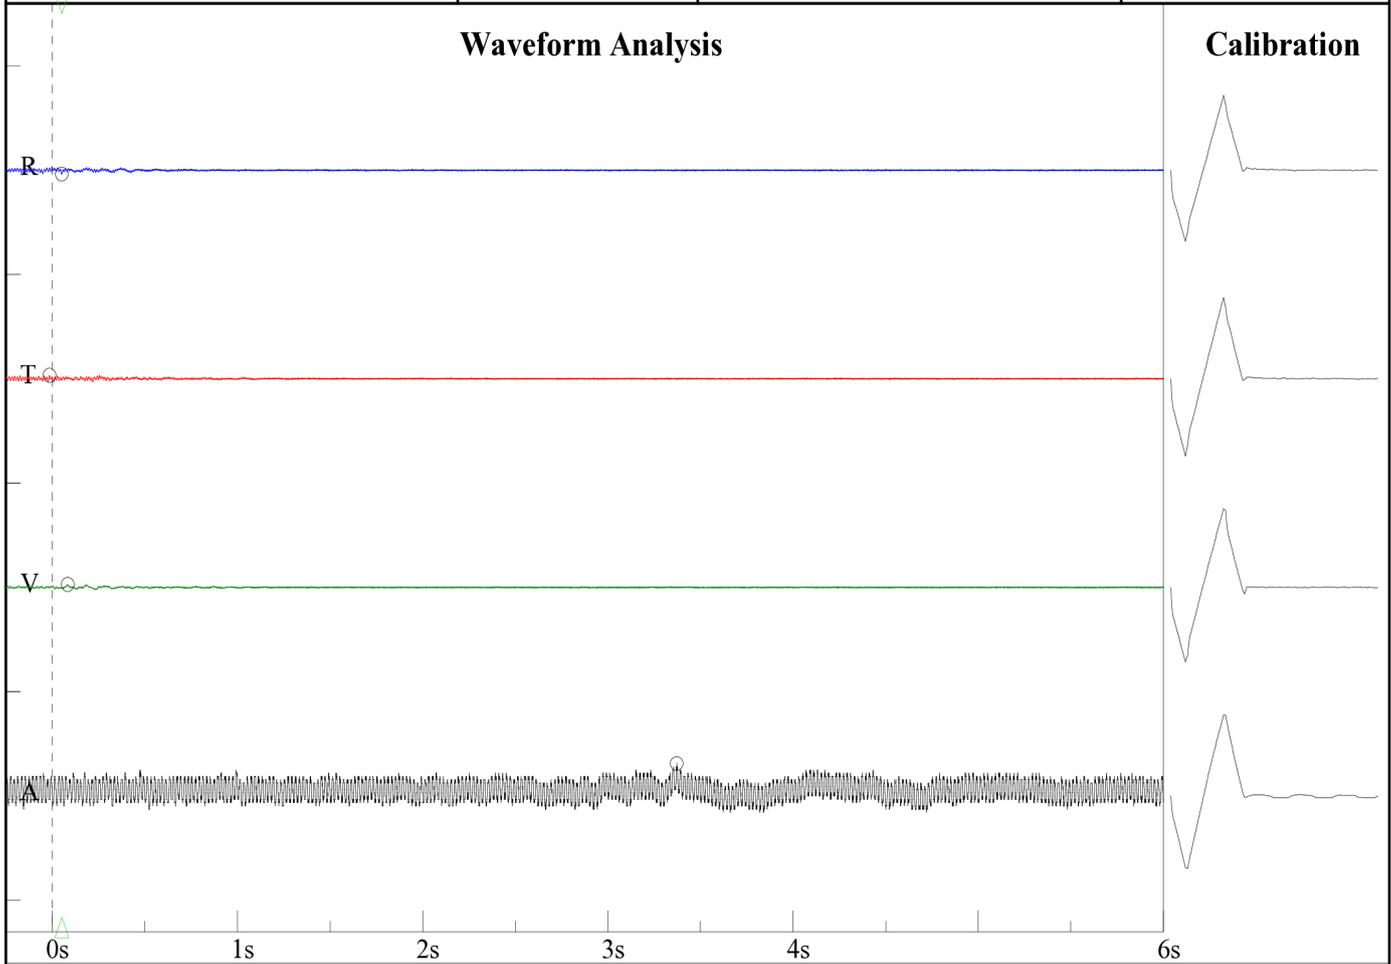

Frequency vs. Amplitude Plot - DIN 4150-3-Table 1

